

**UPFITTER INTEGRATION Bulletin 101.1** 

SUBJECT: Chassis Upfit Electrical Connections MODEL YEARS: 2024 & Beyond AFFECTED MODELS: UU Model THREE INITIATION DATE: 08/29/2023 REVISION: 10/12/2023

## AWARENESS:

**Description of Concern:** Upfitters require Cab and Chassis electrical interface points for adding 12volt power and management for upfit equipment. Electrical access points identification.

 
**Warning:** Do not alter nor add upfit related electrical equipment to the vehicle Safety Systems electrical architecture.

Solution: Approved Upfitter Electrical Access Locations

-Cab Interior Auxiliary Connector (Item 1)



- Pinout Map / Cab Interior Connector



Auxiliary interface Branch and sleeve tied back to trunk line

MULLEN COMMERCIAL

Revision 1

Page 1 of 4

Disclaimer: Service work in association with this Bulletin should only be completed by qualified technicians. It is important to note modifications or alterations to the vehicle could affect the performance of the vehicle also may have safety and warrantee implications. Contact the Mullen Commercial Upfitter Integration Team with any questions regarding the content of this document also if this bulletin applies to your vehicle.



Auxiliary interface					
Hole site	Wire number	Terminal position	Wire diameter	Wire color	Configuration
1	F03Ac	SU F03A	0.5	GY	Reversing signal
2	TLd	SU TL	0.5	GB	Turn left
3	TRd	SU TR	0.5	GW	Turn right
4	SZb	SU SZ	0.5	WU	Auxiliary
5	CAN2H	SU CAN2H	0.5	YR	-
6	CAN6H	MN120/05	0.5	YW	-
7	F08b	SU F08	0.5	UR	ON gear
8	YB4b	SU YB4	0.5	YU	Parking brake
9	-	-	-	-	-
10	-	-	-	-	-
11	CAN2L	SU CAN2L	0.5	RW	-
12	CAN6L	MN120/15	0.5	RB	-
13	-	-	-	-	-
14	T1	CF083: 03	0.5	Υ	All
15	-	-	-	-	-
16	-	-	-	-	-
17	-	-	-	-	-
18	Т2	MN030/11	0.5	G	Delayed power supply
19	E1v	SU E1	0.5	BW	-
20	-	-	-	-	-

## - Pinout Chart / Cab Interior Connector

 
 MULLEN COMMERCIAL
 Revision 1
 Page 2 of 4

 Disclaimer: Service work in association with this Bulletin should only be completed by qualified technicians. It is important to note modifications or alterations to the vehicle action affect the performance of the vehicle also may have safety and warrantee implications. Contact the Mullen Commercial
Upfitter Integration Team with any questions regarding the content of this document also if this bulletin applies to your vehicle.



## **UPFITTER INTEGRATION Bulletin 101.1**

- Chassis 12volt Start Battery Location Access / Aft Cab Aux Bus - Quick Disconnect





## MULLEN COMMERCIAL

Revision 1

Page 3 of 4

Disclaimer: Service work in association with this Bulletin should only be completed by qualified technicians. It is important to note modifications or alterations to the vehicle could affect the performance of the vehicle also may have safety and warrantee implications. Contact the Mullen Commercial Upfitter Integration Team with any questions regarding the content of this document also if this bulletin applies to your vehicle.





- Chassis Tail Lamp / Shipping Location / Harness



- Follow Mullen Upfitter Integration, Body Builder Guide BEST PRACTICES for electrical interface guidance and safety precautions.

Supplemental Content: 2024 Mullen Upfit Guide (mullenusa.com)

Reference; Mullen U.I. Bulletin #101, 103

MULLEN COMMERCIAL

Revision 1

Page 4 of 4

Disclaimer: Service work in association with this Bulletin should only be completed by qualified technicians. It is important to note modifications or alterations to the vehicle could affect the performance of the vehicle also may have safety and warrantee implications. Contact the Mullen Commercial Upfitter Integration Team with any questions regarding the content of this document also if this bulletin applies to your vehicle.