

UPFITTER INTERGRATION Bulletin 106.1

SUBJECT: Rear Tail Lamp Compliance MODEL YEARS: 2024 & Beyond AFFECTED MODELS: UU Model THREE INITIATION DATE: 11/20/2023 REVISION: 1/12/2024

AWARENESS:

Description of Concern: The OEM Rear Tail Lamps included with the Incomplete Chassis are only intended for Second Stage Manufacturer (Upfitter) transport use. These temporary Lamps may not meet FMVSS requirements for compliance and DOT use.

The Rear Tail Lamp circuit also includes a Rear Fog Lamp feature that should be disabled (see Mullen U.I. Bulletin #105).

Solution: The Second Stage Manufacturer (Upfitter) is responsible to certify the completed vehicle meets all local, state, and federal FMVSS requirements. The Upfitter must use Rear Tail Lamp units that are DOT approved and meet FMVSS requirements for a `Completed Vehicle'.



Above reference temporary OEM Rear Tail Lamps included with Incomplete chassis.



`Light Bar Mounting' Recommended Replacement Lamps (or equivalent)





Manufacturer / Type	MOPAR / Incandescent (Direct plug-in DOT replacement for Mullen Units)
Item Weight	1 pound (each)
Product Dimensions	12.25 x 5.5 x 4.25 inches
Item Model	RAM Promaster 2500 Cab Chassis (2014-2021)
Manufacturer Part Number	P68169777AC(Right), P68169778AC(Left)
	(Right-Passenger Side shown above)



`Light Bar Mounting'

Recommended Replacement Lamps (or equivalent)



Manufacturer / Type	ISUZU / Incandescent (requires wiring adaption)
Item Weight	1 pound (each)
Product Dimensions	12.7 x 8 x 2.7 inches
Item Model	NPR, NQR, NRR Tail Light
Manufacturer Part Number	8-97065-809-0(Right),8-97065-810-0(Left)
	(Right-Passenger Side shown above)



`Surface Mounting' Recommended Replacement Lamp (or equivalent)





Manufacturer/ type	Partsam / LED Triple Taillights 45 LEDs (requires wiring adaption)
Item Weight	1 pound
Overall Dimensions	14.2 x 7 x 1 inches
Item model	LED Triple Taillights
Manufacturer Part Number	GTCV-0606105670 (2 Required)

Supplemental Content: 2024 Mullen Upfit Guide (mullenusa.com)

Reference; Mullen U.I. Bulletin #101, #105

MULLEN COMMERCIAL Revision 1 Page 4 of 4
Disclaimer: Service work in association with this Bulletin should only be completed by qualified technicians. It is important to note modifications or